









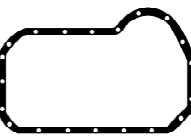
















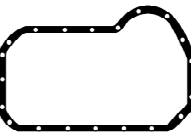
















VOLKSWAGEN												
Ltr.			<b>1</b>									
1,6 AD AE AF AH	34-37 kW (47-50 PS)	TRANSPORTER	08/67-07/79	<b>01-12714-03</b> <sup>16</sup> 111 198 007 <b>15-19670-04</b> <sup>16</sup> 111 198 007 A  <b>03-19670-03</b> <sup>16</sup> <sup>18</sup> 113 198 101 A  <b>13-18254-01</b> <sup>5</sup> 113 198 031			<b>71-21644-30</b> 2x 113 101 481 F 		<b>41-72077-30</b> 2x 311 129 707  <b>71-22775-00</b> 2x 113 129 717 A 		<b>71-19670-20</b> 4x 111 251 261 C 	<b>81-15287-30 K</b> → 113 105 245 F 70x90x10 ALD ACM
1,6 AS CT	37 kW (50 PS)	TRANSPORTER	08/68-12/82	<b>01-21644-02</b> <sup>13</sup> <b>13-18254-01</b> <sup>5</sup> 113 198 031		<b>71-21644-30</b> 2x 113 101 481 F 		<b>71-22775-00</b> 2x 113 129 717 A 		<b>71-19670-20</b> 4x 111 251 261 C 	<b>81-15287-30 K</b> → 113 105 245 F 70x90x10 ALD ACM	
1,6 CS	37 kW (50 PS)	TRANSPORTER	01/81-07/87	<b>02-12947-07</b> <sup>12</sup> 068 198 012 L  <b>08-12948-09</b> <sup>13</sup> 037 198 011 C	<b>61-25375-00</b> 068 103 383 ES 78 Ø 1,5 mm 1 Mot.→CS 000 338 <b>61-25375-10</b> 068 103 383 ET 78 Ø 1,6 mm 2 Mot.→CS 000 338 <b>61-25375-20</b> 068 103 383 FA 78 Ø 1,7 mm 3 Mot.→CS 000 338 	<b>14-32047-01</b> 068 103 384 A (10x) Mot.CS 000 339→ 	<b>15-12947-02</b> 026 198 025 A 8,5 mm Kork  <b>15-31692-01</b> 026 198 025 C 6,5 mm Gummi  1 Dichtlippe	<b>12-25837-01</b> 026 109 675 (8x) <b>70-25837-00</b> 026 109 675 8x	<b>71-25927-20</b> 026 129 717 D 	<b>71-27898-20</b> 4x 026 129 589 A  <b>71-23143-10</b> <sup>13</sup> 811 253 115 A Mot.CS 000 339→  <b>71-25928-00</b> <sup>13</sup> 171 253 115 Mot.CS 000 339→ 	<b>10-33138-01</b> 044 103 609 D +N 905 927 02 (20x) Gummi  <b>71-12948-10</b> 026 103 609 D 	<b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM

VOLKSWAGEN												
1,6 JX	51 kW (69-70 PS)	TRANSPORTER	08/84-07/92	<p><b>02-12947-08</b> <sup>12</sup> 068 198 012 E</p>  <p><b>08-12948-09</b> <sup>13</sup> 037 198 011 C</p>	<p><b>61-29025-40</b> 068 103 383 FE 78 Ø 1,6 mm 1 </p> <p><b>61-29025-50</b> 068 103 383 FF 78 Ø 1,65 mm 2 </p> <p><b>61-29025-60</b> 068 103 383 FG 78 Ø 1,7 mm 3 </p> 	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> 	<p><b>15-12947-02</b> 026 198 025 A 8,5 mm Kork</p>  <p><b>15-31692-01</b> 026 198 025 C 6,5 mm Gummi</p>  <p>1 Dichtlippe</p>	<p><b>12-25837-01</b> 026 109 675 (8x) <b>70-25837-00</b> 026 109 675</p>	<p><b>71-24616-20</b> 068 129 717 E</p>  <p>8x</p>	<p><b>71-27898-20 R</b> 026 129 589 A</p>  <p>2x</p> <p><b>71-28186-20 L</b> 034 129 589 B</p>  <p>2x</p> <p><b>71-25111-10</b> <sup>14</sup> </p> <p>893 253 115</p> 	<p><b>10-33138-01</b> 044 103 609 D +N 905 927 02 (20x) Gummi</p>  <p>2x</p> <p><b>71-12948-10</b> 026 103 609 D</p> 	<p><b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p><b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
1,7 CA CB	49 kW (66-67 PS)	TRANSPORTER	08/71-12/73	<p><b>01-21925-03</b> <sup>16</sup> 021 198 009 D</p> <p><b>13-21729-02</b> <sup>5</sup> 021 198 031 B</p>	<p><b>61-21925-00</b> 4x 021 101 343 90 Ø 0,7 mm</p> 	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> 	<p><b>71-21728-00</b> 2x 021 101 481</p> 	<p><b>71-23213-00</b> 4x 021 129 707 D</p> 	<p><b>71-21736-10</b> 4x 021 256 251 A</p>  <p><b>71-21911-30</b> <sup>14</sup> </p> <p>025 251 261</p>  <p>2x</p>	<p><b>81-21001-10 K</b> ← 021 105 247 A 42x62x10 A SL RD ACM</p> <p><b>81-25946-00 K</b> → 029 105 245 B 75x95x10 A LD ACM FPM</p>		
1,7 KY	42 kW (57 PS)	TRANSPORTER	10/86-07/92	<p><b>02-12947-06</b> <sup>12</sup> 033 198 012 A</p>  <p><b>08-12948-09</b> <sup>13</sup> 037 198 011 C</p>	<p><b>61-27515-30</b> 033 103 383 K 81 Ø 1,53 mm 1 </p> <p><b>61-27515-40</b> 033 103 383 L 81 Ø 1,57 mm 2 </p> <p><b>61-27515-50</b> 033 103 383 M 81 Ø 1,61 mm 3 </p> 	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> 	<p><b>15-12947-02</b> 026 198 025 A 8,5 mm Kork</p>  <p><b>15-31692-01</b> 026 198 025 C 6,5 mm Gummi</p>  <p>1 Dichtlippe</p>	<p><b>12-25837-01</b> 026 109 675 (8x) <b>70-25837-00</b> 026 109 675</p>	<p><b>71-27206-20</b> 033 129 717 B</p>  <p>8x</p>	<p><b>71-27898-20 R</b> 026 129 589 A</p>  <p>2x</p> <p><b>71-28186-20 L</b> 034 129 589 B</p>  <p>2x</p> <p><b>71-23143-10</b> <sup>14</sup> </p> <p>811 253 115 A</p> 	<p><b>10-33138-01</b> 044 103 609 D +N 905 927 02 (20x) Gummi</p>  <p>2x</p> <p><b>71-12948-10</b> 026 103 609 D</p> 	<p><b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p><b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
1,8 AP	50 kW (68 PS)	TRANSPORTER	11/73-07/75	<p><b>01-23455-05</b> <sup>16</sup> 029 198 009 A</p> <p><b>13-21729-02</b> <sup>5</sup> 021 198 031 B</p>	<p><b>61-23410-00</b> 4x 021 101 343 A 93 Ø 0,7 mm</p> 	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> 	<p><b>71-21728-00</b> 2x 021 101 481</p> 	<p><b>71-23374-00</b> 4x 021 129 707 E</p> 	<p><b>71-23211-10</b> 4x 039 256 251</p>  <p><b>71-21911-30</b> <sup>14</sup> </p> <p>025 251 261</p>  <p>2x</p>	<p><b>81-25946-00 K</b> → 029 105 245 B 75x95x10 A LD ACM FPM</p>		
1,8 PD	49 kW (67 PS)	TRANSPORTER	12/90-07/92	<p><b>02-29300-01</b> <sup>12</sup> 044 198 012</p> <p><b>08-12948-12</b> <sup>13</sup> 044 198 011 A</p>	<p><b>61-29300-00</b> 044 103 383 D 82,5 Ø</p> 	<p><b>14-32045-01</b> 049 103 385 (10x)</p> 	<p><b>15-12947-02</b> 026 198 025 A 8,5 mm Kork</p>  <p><b>15-31692-01</b> 026 198 025 C 6,5 mm Gummi</p>  <p>1 Dichtlippe</p>	<p><b>12-25837-01</b> 026 109 675 (8x) <b>70-25837-00</b> 026 109 675</p>	<p><b>71-25927-20</b> 026 129 717 D</p>  <p>8x</p>	<p><b>71-27898-20</b> 026 129 589 A</p>  <p>4x</p>	<p><b>10-33138-01</b> 044 103 609 D +N 905 927 02 (20x) Gummi</p>  <p>2x</p> <p><b>71-12948-10</b> 026 103 609 D</p> 	<p><b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p><b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>

VOLKSWAGEN												
Ltr.			<b>1</b>									
1,9 ABL	50 kW (68 PS)	TRANSPORTER	10/92-04/03	<b>02-28777-01</b> <sup>12</sup> 028 198 012 B Mot.→ABL 076 000  <b>08-23134-02</b> <sup>13</sup> 044 198 011 	<b>61-31225-30</b> 028 103 383 BH 81 Ø 1,53 mm 1 MLS <b>61-31225-40</b> 028 103 383 BJ 81 Ø 1,57 mm 2 MLS <b>61-31225-50</b> 028 103 383 BK 81 Ø 1,61 mm 3 MLS 	<b>14-32047-01</b> 068 103 384 A (10x) 	<b>15-28777-01</b> 028 198 025 	<b>12-25837-01</b> 026 109 675 (8x) Mot.→ABL 076 000 <b>12-26058-02</b> 027 109 675 (8x) Mot.ABL 076 001→ <b>70-25837-00</b> 8x 026 109 675 Mot.→ABL 076 000 <b>70-26058-00</b> 8x 027 109 675 Mot.ABL 076 001→	<b>71-28781-10</b> 028 129 717 D 	<b>71-27898-20</b> 026 129 589 A 	4x <b>71-31943-00</b> 037 115 220 B Mot.→ABL 070 000  <b>71-33138-00</b> 044 103 609 D Gummi Mot.ABL 070 001 - 076 00→ 	<b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,9 AFD	58 kW (79 PS)			<b>02-31257-02</b> <sup>12</sup> 028 198 012 F  <b>08-23134-03</b> <sup>13</sup> 028 198 011 D Mot.→AFD 000 999  <b>08-23134-04</b> <sup>13 35</sup> Mot.AFD 001 000→ 	<b>61-33120-30</b> 028 103 383 BL 81 Ø 1,45 mm 1 MLS <b>61-33120-40</b> 028 103 383 BM 81 Ø 1,53 mm 2 MLS <b>61-33120-50</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>14-32047-01</b> 068 103 384 A (10x) 	<b>15-31257-01</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675 	<b>71-28781-10</b> 028 129 717 D 	<b>71-27898-20 L</b> 026 129 589 A  <b>71-28186-20 R</b> 034 129 589 B 	2x <b>70-31414-10</b>  2x <b>71-33138-00</b> 044 103 609 D Gummi 	<b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM Mot.→AFD 000 999 028 103 171 B <b>81-90000-00 K</b> → Mot.AFD 001 000→ <b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,9 ANC	44 kW (60 PS)			<b>02-33838-01</b> <sup>12</sup> 038 198 012   <b>08-36871-01</b> <sup>13 38</sup>	<b>61-31980-00</b> 038 103 383 AL 80,5 Ø 1,47 mm 1 MLS <b>61-31980-10</b> 038 103 383 AM 80,5 Ø 1,57 mm 2 MLS <b>61-31980-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS 	<b>14-32047-01</b> 068 103 384 A (10x) 		<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675 	<b>71-28781-10</b> 028 129 717 D 	<b>71-27898-20 R</b> 026 129 589 A  <b>71-28186-20 L</b> 034 129 589 B 	2x <b>70-31414-10</b>  2x	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00 K</b> → 06A 103 171 A PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

VOLKSWAGEN													
Ltr.													
1,9 ARD AVM BEQ BEU BJC	33-63 kW (45-86 PS)		1	 <b>02-33838-01</b> <sup>12</sup> 038 198 012  <b>08-35038-01</b> <sup>13 35</sup>	<b>61-31980-00</b> 038 103 383 AL 80,5 Ø 1,47 mm 1 <input type="checkbox"/> MLS <b>61-31980-10</b> 038 103 383 AM 80,5 Ø 1,57 mm 2 <input type="checkbox"/> MLS <b>61-31980-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 <input type="checkbox"/> MLS 	<b>14-32047-01</b> 068 103 384 A (10x) 		<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-28781-10</b> 028 129 717 D 8x 		<b>71-31957-00</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00 K</b> → 06A 103 171 A PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,9 AXB AXC	63-77 kW (85-105 PS)	TRANSPORTER	04/03-11/09	 <b>02-34302-01</b> <sup>12</sup>  <b>08-35038-01</b> <sup>13 35</sup>	<b>61-34250-00</b> 038 103 383 DE 81 Ø 1,45 mm 1 <input type="checkbox"/> MLS <b>61-34250-10</b> 038 103 383 DF 81 Ø 1,53 mm 2 <input type="checkbox"/> MLS <b>61-34250-20</b> 038 103 383 DG 81 Ø 1,61 mm 3 <input type="checkbox"/> MLS 	<b>14-32121-01</b> 038 103 384 (10x) 	<b>71-35884-00</b> 038 103 483 D 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-28781-10</b> 028 129 717 D 8x 		<b>71-31957-00</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00 K</b> → 06A 103 171 A PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,9 BRR BRS	62-75 kW (84-102 PS)	TRANSPORTER	01/06-11/09	 <b>02-37596-01</b> <sup>12</sup>  <b>08-35038-02</b> <sup>13 35</sup>	<b>61-34250-00</b> 038 103 383 DE 81 Ø 1,45 mm 1 <input type="checkbox"/> MLS <b>61-34250-10</b> 038 103 383 DF 81 Ø 1,53 mm 2 <input type="checkbox"/> MLS <b>61-34250-20</b> 038 103 383 DG 81 Ø 1,61 mm 3 <input type="checkbox"/> MLS 	<b>14-32121-01</b> 038 103 384 (10x) 	<b>71-37596-00</b> 03G 103 483 F 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-28781-10</b> 028 129 717 D 8x 		<b>71-31957-00</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90018-00 K</b> → 038 103 171 S PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

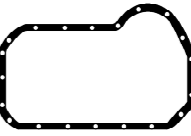VOLKSWAGEN													
Ltr.			<b>1</b>										
1,9 CDXA CDXB	29-55 kW (40-75 PS)			<b>02-33838-01</b> <sup>12</sup> 038 198 012   <b>08-36871-01</b> <sup>13 38</sup>	<b>61-31980-00</b> 038 103 383 AL 80,5 Ø 1,47 mm 1 MLS <b>61-31980-10</b> 038 103 383 AM 80,5 Ø 1,57 mm 2 MLS <b>61-31980-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS 	<b>14-32047-01</b> 068 103 384 A (10x) 		<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-28781-10</b> 028 129 717 D 8x		<b>71-27898-20 L</b> 026 129 589 A 2x <b>71-28186-20 R</b> 034 129 589 B 2x	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00 K</b> → 06A 103 171 A PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,9 DF DG DH GW	44-66 kW (60-90 PS)	TRANSPORTER	08/82-07/92	<b>01-25315-02</b> <sup>13 16</sup> 025 198 009 B <b>02-25315-03</b> <sup>18</sup> 025 198 012 B 2x	<b>61-25315-10</b> 025 101 343 B 4x 95 Ø 1,05 mm  <b>71-25975-00</b> 025 101 345 2x 	<b>71-21644-30</b> 113 101 481 F 2x 		<b>71-25543-10</b> 025 129 717 E 2x 		<b>71-25283-40</b> N 901 316 02 4x  <b>71-23411-10</b> <sup>19</sup> 2x 025 251 235 		<b>81-25944-10 K</b> ← 025 105 247 A 48x68x10 A SL RD FPM <b>81-25946-00 K</b> → 029 105 245 B 75x95x10 A LD ACM FPM	
1,9 1X	44-45 kW (60-61 PS)	TRANSPORTER	07/90-12/95	<b>02-28777-01</b> <sup>12</sup> 028 198 012 B   <b>08-23134-02</b> <sup>13</sup> 044 198 011 	<b>61-29000-30</b> 028 103 383 BB 81 Ø 1,6 mm 1 Mot.→1X 104 630 <b>61-29000-40</b> 028 103 383 BC 81 Ø 1,65 mm 2 Mot.→1X 104 630 <b>61-29000-50</b> 028 103 383 BD 81 Ø 1,7 mm 3 Mot.→1X 104 630  <b>61-31225-30</b> 028 103 383 BH 81 Ø 1,53 mm 1 MLS Mot.1X 104 631→ <b>61-31225-40</b> 028 103 383 BJ 81 Ø 1,57 mm 2 MLS Mot.1X 104 631→ <b>61-31225-50</b> 028 103 383 BK 81 Ø 1,61 mm 3 MLS Mot.1X 104 631→ 	<b>14-32047-01</b> 068 103 384 A (10x) 	<b>15-28777-01</b> 028 198 025 	<b>12-25837-01</b> 026 109 675 (8x) <b>70-25837-00</b> 026 109 675	<b>71-28781-10</b> 028 129 717 D 8x		<b>71-27898-20</b> 026 129 589 A 4x 	<b>71-31943-00</b> 037 115 220 B 	<b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM

VOLKSWAGEN												
2,0 AAC	62 kW (84 PS)	TRANSPORTER	07/90-04/03	<b>02-29300-01</b> <sup>12</sup> 044 198 012 <b>08-23134-02</b> <sup>13</sup> 044 198 011 	<b>61-29300-00</b> 044 103 383 D 82,5 Ø 	<b>14-32047-01</b> 068 103 384 A (10x) 	<b>15-12947-02</b> 026 198 025 A 8,5 mm Kork  <b>15-31692-01</b> 026 198 025 C 6,5 mm Gummi  1 Dichtlippe	<b>12-25837-01</b> 026 109 675 (8x) <b>70-25837-00</b> 026 109 675 8x	<b>71-29173-00</b> 048 129 717 A 	<b>71-27898-20</b> 026 129 589 A 4x 	<b>71-31943-00</b> 037 115 220 B 	<b>81-19299-10 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM
2,0 AXA	85 kW (115 PS)	TRANSPORTER	11/03→	<b>02-34140-03</b> <sup>12</sup> <b>08-35038-01</b> <sup>13 35</sup>	<b>61-34140-10</b> 06A 103 383 AN MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-34212-00</b> 06A 103 483 C 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-31983-00</b> 037 129 717 C 8x  <b>71-34943-00</b> <sup>10</sup> 06A 129 717 F 	<b>71-34216-00</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00 K</b> → 06A 103 171 A PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 CAAA CAAB CAAC CAAD CAAE CCHA CCHB	62-103 kW (84-140 PS)	TRANSPORTER TDI	09/09→	<b>02-40486-01</b> <sup>12</sup>  <b>08-40848-01</b> <sup>13 35</sup>	<b>61-37175-00</b> 03L 103 383 AM 82 Ø 1,55 mm 1 □ MLS <b>61-37175-10</b> 03L 103 383 AN 82 Ø 1,63 mm 2 □ MLS <b>61-37175-20</b> 03L 103 383 AP 82 Ø 1,71 mm 3 □ MLS 	<b>14-32299-01</b> WHT 002 131 (10x) 	<b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)  <b>71-40486-00</b> 03L 103 483 C 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x	<b>71-40507-00</b> 03L 129 717 E 16x 	<b>71-37422-00</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90052-00 K</b> → 03L 103 171 A PTFE <b>81-40538-00 N</b> 03L 103 085 32x47x10 ARD FPM
2,0 CBHA CBKA	47-74 kW (64-101 PS)			<b>02-37594-01</b> <sup>12</sup>  <b>08-35038-02</b> <sup>13 35</sup>	<b>61-34810-00</b> 038 103 383 CP 82 Ø 1,45 mm 1 □ MLS <b>61-34810-10</b> 038 103 383 CQ 82 Ø 1,53 mm 2 □ MLS <b>61-34810-20</b> 038 103 383 CR 82 Ø 1,61 mm 3 □ MLS 	<b>14-32121-01</b> 038 103 384 (10x) 	<b>71-37594-00</b> 03G 103 483 D 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-28781-10</b> 028 129 717 D 8x 	<b>71-37533-00</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90018-00 K</b> → 038 103 171 S PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM



VOLKSWAGEN														
Ltr.														
2,0 CBJB	55 kW (75 PS)				<p><b>02-34302-01</b> <sup>12</sup></p> <p><b>08-35038-02</b> <sup>13 35</sup></p>	<p><b>61-34810-00</b> 038 103 383 CP 82 Ø 1,45 mm 1 </p> <p>MLS</p> <p><b>61-34810-10</b> 038 103 383 CQ 82 Ø 1,53 mm 2 </p> <p>MLS</p> <p><b>61-34810-20</b> 038 103 383 CR 82 Ø 1,61 mm 3 </p> <p>MLS</p>	<p><b>14-32121-01</b> 038 103 384 (10x)</p>	<p><b>71-35884-00</b> 038 103 483 D</p>	<p><b>12-26058-02</b> 027 109 675 (8x)</p> <p><b>70-26058-00</b> 027 109 675</p>	<p><b>71-28781-10</b> 028 129 717 D</p> <p>8x</p>		<p><b>71-31957-00</b> 037 253 039 D</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90018-00 K</b> → </p> <p>038 103 171 S PTFE</p> <p><b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,0 CBSA	37 kW (50 PS)				<p><b>02-37040-01</b> <sup>12</sup></p> <p><b>08-35038-01</b> <sup>13 35</sup></p>	<p><b>61-37040-00</b> 06G 103 383 A MLS</p>	<p><b>14-32126-01</b> 06A 103 384 C (10x)</p>	<p><b>71-34212-00</b> 06A 103 483 C</p>	<p><b>12-26058-02</b> 027 109 675 (8x)</p> <p><b>70-26058-00</b> 027 109 675</p>	<p><b>40-76854-00</b> 4x 06A 129 717 D</p>		<p><b>71-34216-00</b> 06A 253 039 L</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90010-00 K</b> → </p> <p>06A 103 171 A PTFE</p> <p><b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,0 CFCA	132 kW (180 PS)	TRANSP.	→7H-F-999 999, 09/09→ 7J-F-999 999		<p><b>02-40486-02</b> <sup>12</sup></p> <p><b>08-40848-01</b> <sup>13 35</sup></p>	<p><b>61-37175-00</b> 03L 103 383 AM 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-37175-10</b> 03L 103 383 AN 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-37175-20</b> 03L 103 383 AP 82 Ø 1,71 mm 3 </p> <p>MLS</p>	<p><b>14-32299-01</b> WHT 002 131 (10x)</p>	<p><b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)</p> <p><b>71-40486-00</b> 03L 103 483 C</p>	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-40507-00</b> 03L 129 717 E</p> <p>16x</p>		<p><b>71-40497-00</b> 03L 253 039 F</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90052-00 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM</p>
2,0 CFCA	132 kW (180 PS)	TRANSP.	7H-F-000 001, 09/09→ 7H-G-000 001→		<p><b>02-40486-02</b> <sup>12</sup></p> <p><b>08-40848-01</b> <sup>13 35</sup></p>	<p><b>61-10140-00</b> 03L 103 383 DC 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-10140-10</b> 03L 103 383 DD 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-10140-20</b> 03L 103 383 DE 82 Ø 1,71 mm 3 </p> <p>MLS</p>	<p><b>14-32299-01</b> WHT 002 131 (10x)</p>	<p><b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)</p> <p><b>71-40486-00</b> 03L 103 483 C</p>	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-40507-00</b> 03L 129 717 E</p> <p>16x</p>		<p><b>71-40497-00</b> 03L 253 039 F</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90052-00 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM</p>



VOLKSWAGEN													
Ltr.			<b>1</b>										
2,0 CH	55 kW (75 PS)	LT	04/75-09/83	<b>02-23860-04</b> <sup>12</sup> 060 198 012 D <b>08-23874-02</b> <sup>13</sup> 060 198 011 B	<b>61-23860-20</b> 046 103 383 J 88,5 Ø 1,75 mm 	<b>14-32047-01</b> 068 103 384 A (10x) Mot.0008796→ 	<b>15-23902-02</b> 060 198 025 A 	<b>12-25247-01</b> 046 109 675 A (8x) <b>70-25247-00</b> 046 109 675 A	<b>71-25072-10</b> 060 129 717 A 8x 		<b>71-23918-20</b> 060 129 589 C <b>71-23837-10</b> <sup>14</sup> <sup>15</sup> 060 253 115 C 	<b>10-23874-02</b> 060 198 041 A 	<b>81-24289-00</b> K ← 048 115 147 35x54x10 A SL RD ACM <b>81-20589-20</b> K → 059 103 051 D 96x117x12 A SL LD FPM <b>81-19299-10</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,0 CJ GE	51 kW (69-70 PS)	TRANSPORTER	08/75-07/79	<b>01-23455-05</b> <sup>16</sup> 029 198 009 A <b>13-21729-02</b> <sup>5</sup> 021 198 031 B	<b>61-23455-00</b> 4x 039 101 343 B 94 Ø 0,7 mm 		<b>71-21728-00</b> 2x 021 101 481 		<b>71-23374-00</b> 4x 021 129 707 E 		<b>71-23211-10</b> 4x 039 256 251 	<b>71-21911-30</b> <sup>17</sup> 2x 025 251 261 	<b>81-21001-10</b> K ← 021 105 247 A 42x62x10 A SL RD ACM <b>81-25946-00</b> K → 029 105 245 B 75x95x10 A LD ACM FPM
2,0 CJK CJKB	110-150 kW (150-204 PS)	TRANSPORTER TSI	05/11→	<b>02-37475-01</b> <sup>12</sup> <b>08-39129-02</b> <sup>13</sup> <sup>35</sup>	<b>61-37475-00</b> 06H 103 383 AD 83 Ø MLS 	<b>14-32276-01</b> 06D 103 385 D (10x) 	<b>70-31414-10</b> 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675	<b>71-36072-00</b> 16x 06F 129 717 D 		<b>71-37511-00</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>81-42737-00</b> K ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM <b>81-90037-00</b> K → <sup>18</sup> 06H 103 171 F PTFE







VOLKSWAGEN												
Ltr.    1 2,0 CKTB CKTC CKUB CKUC CSNA <b>[NEW]</b>	80-120 kW (109-163 PS)	CRAFTER TDI	05/11→	 <b>02-40486-03</b> <sup>12</sup>  <b>08-40848-01</b> <sup>13 35</sup>	<b>61-37175-00</b> 03L 103 383 AM 82 Ø 1,55 mm 1 MLS →10/13 <b>61-37175-10</b> 03L 103 383 AN 82 Ø 1,63 mm 2 MLS →10/13 <b>61-37175-20</b> 03L 103 383 AP 82 Ø 1,71 mm 3 MLS →10/13  <b>61-10140-00</b> 03L 103 383 DC 82 Ø 1,55 mm 1 MLS 11/13→ <b>61-10140-10</b> 03L 103 383 DD 82 Ø 1,63 mm 2 MLS 11/13→ <b>61-10140-20</b> 03L 103 383 DE 82 Ø 1,71 mm 3 MLS 11/13→ 	<b>14-32299-01</b> WHT 002 131 (10x) 	<b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)  <b>71-40486-00</b> 03L 103 483 C 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x	<b>71-40506-00</b> 03L 129 717 D 	<b>71-40504-00</b> 03L 253 039 G 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90052-00 K</b> → 03L 103 171 A PTFE <b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM
2,0 CSLB <b>[NEW]</b>	84 kW (114 PS)	CRAFTER TDI	11/13→	 <b>02-40486-03</b> <sup>12</sup>  <b>08-40848-01</b> <sup>13 35</sup>	<b>61-10140-00</b> 03L 103 383 DC 82 Ø 1,55 mm 1 MLS <b>61-10140-10</b> 03L 103 383 DD 82 Ø 1,63 mm 2 MLS <b>61-10140-20</b> 03L 103 383 DE 82 Ø 1,71 mm 3 MLS 	<b>14-32299-01</b> WHT 002 131 (10x) 	<b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)  <b>71-40486-00</b> 03L 103 483 C 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x	<b>71-40506-00</b> 03L 129 717 D 	<b>71-40504-00</b> 03L 253 039 G 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90052-00 K</b> → 03L 103 171 A PTFE <b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM



VOLKSWAGEN												
Ltr.			<b>1</b>									
2,0 CU CV	51 kW (69-70 PS)	TRANSPORTER	05/79-04/86	<b>01-23455-04</b> <sup>16</sup> 071 198 009 A <b>13-21729-02</b> <sup>5</sup> 021 198 031 B	<b>61-23455-00</b> 4x 039 101 343 B 94 Ø 0,7 mm 		<b>71-21728-00</b> 2x 021 101 481 		<b>71-23374-00</b> 4x 021 129 707 E 		<b>71-24546-20 L</b> 2x 029 256 251 A  <b>71-24547-20 R</b> 2x 029 256 252 A  <b>71-21911-30</b> <sup>Δ</sup> 2x 025 251 261 	<b>81-21001-10 K</b> ← 021 105 247 A 42x62x10 A SL RD ACM <b>81-25946-00 K</b> → 029 105 245 B 75x95x10 A LD ACM FPM
2,1 DJ MV SR SS	64-82 kW (87-112 PS)	TRANSPORTER	08/84-07/92	<b>01-25315-02</b> <sup>13</sup> <sup>16</sup> 025 198 009 B <b>02-25315-03</b> <sup>18</sup> 2x 025 198 012 B	<b>61-25315-10</b> 4x 025 101 343 B 95 Ø 1,05 mm  <b>71-25975-00</b> 2x 025 101 345 		<b>71-21644-30</b> 2x 113 101 481 F 		<b>71-25943-10</b> 2x 025 129 717 C 		<b>71-25283-40</b> 4x N 901 316 02  <b>71-23411-10</b> <sup>Δ</sup> <sup>X</sup> 2x 025 251 235 	<b>81-25944-10 K</b> ← 025 105 247 A 48x68x10 A SL RD FPM <b>81-25946-00 K</b> → 029 105 245 B 75x95x10 A LD ACM FPM
2,3 AGL	105 kW (143 PS)	LT	05/96-07/06	<b>02-29415-01</b> 00A 198 012  <b>08-29170-01</b> <sup>13</sup> 00A 198 011	<b>61-29415-00</b> 00A 103 383 92 Ø 1,75 mm 	<b>14-32028-02</b> 00A 103 385 (10x) 	<b>15-31001-01</b> 00A 103 483 +00A 103 484 (4x) 	<b>12-29491-01</b> 00A 198 675 <b>70-29491-00</b> 00A 109 675	<b>71-29176-00</b> 16x 00A 133 227 	<b>71-29349-00</b> 00A 253 039 	<b>71-29170-10</b> 00A 103 609 A 	<b>81-26248-00 K</b> ← 00A 103 085 A 45x67x8 A SL RD FPM <b>81-26249-00 K</b> → 00A 103 085 93x114x13 A SL LD FPM
2,4 AAB	57 kW (78 PS)	TRANSP. → R 160 000	07/90-09/98	<b>02-28988-01</b> <sup>12</sup> 074 198 012  <b>08-29178-03</b> <sup>13</sup> 074 198 011 B	<b>61-29210-00</b> 074 103 383 C 81 Ø 1,53 mm 1 Mot.→AAB 110 000 <b>61-29210-10</b> 074 103 383 D 81 Ø 1,57 mm 2 Mot.→AAB 110 000 <b>61-29210-20</b> 074 103 383 E 81 Ø 1,61 mm 3 Mot.→AAB 110 000  <b>61-29471-30</b> 074 103 383 M 81 Ø 1,53 mm 1 MLS Mot.AAB 110 001→ <b>61-29471-40</b> 074 103 383 N 81 Ø 1,57 mm 2 MLS Mot.AAB 110 001→ <b>61-29471-50</b> 074 103 383 P 81 Ø 1,61 mm 3 MLS Mot.AAB 110 001→ 	<b>14-32047-02</b> 068 103 384 A (12x) 	<b>15-28988-01</b> 	<b>12-25837-02</b> 026 109 675 (10x) <b>70-25837-00</b> 026 109 675	<b>71-29179-00</b> 10x 074 129 717 	<b>71-27898-20</b> 5x 026 129 589 A 	<b>71-29178-10</b> 074 103 609 F 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM

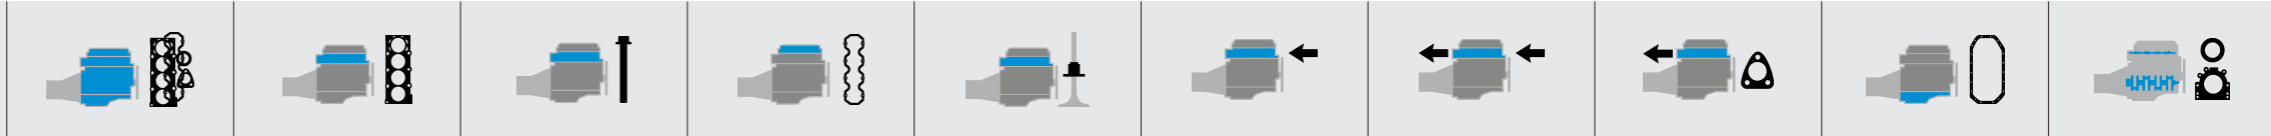
VOLKSWAGEN

Ltr.    1  
 2,4 AAB 57 kW (78 PS) TRANSP. 70 R 160 001→ 07/90-09/98





**02-28988-02** <sup>12</sup>  
074 198 012 A  
  
**02-28988-03** <sup>12</sup>  
  
  
**08-29178-03** <sup>13</sup>  
074 198 011 B


**61-29210-00**  
074 103 383 C  
81 Ø  
1,53 mm 1   
Mot.→AAB 110 000  
**61-29210-10**  
074 103 383 D  
81 Ø  
1,57 mm 2   
Mot.→AAB 110 000  
**61-29210-20**  
074 103 383 E  
81 Ø  
1,61 mm 3   
Mot.→AAB 110 000  
  
**61-29471-30**  
074 103 383 M  
81 Ø  
1,53 mm 1   
MLS  
Mot.AAB 110 001→  
**61-29471-40**  
074 103 383 N  
81 Ø  
1,57 mm 2   
MLS  
Mot.AAB 110 001→  
**61-29471-50**  
074 103 383 P  
81 Ø  
1,61 mm 3   
MLS  
Mot.AAB 110 001→  


**14-32047-02**  
068 103 384 A (12x)  


**12-25837-02**  
026 109 675 (10x)  
**70-25837-00**  
026 109 675

**71-29179-00**  
074 129 717  
10x 

**71-27898-20**  
026 129 589 A  


5x **71-29178-10**  
074 103 609 F  


























**81-24292-10 K** ←  
054 115 147 B  
35x48x10  
A SL RD FPM  
**81-23708-40 K** →  
068 103 051 P  
85x105x11  
A SL LD FPM  
**81-19299-10 N** 2x  
068 103 085 E  
32x47x10  
A SL WD FPM



VOLKSWAGEN

Ltr.    1

2,4 ACL 70 kW (95 PS) LT TD 06/92-06/96

									
	<p><b>61-28990-00</b> 072 103 383 CT 78 Ø 1,5 mm 1  Mot.→ACL 014 031</p> <p><b>61-28990-10</b> 072 103 383 DA 78 Ø 1,55 mm 2  Mot.→ACL 014 031</p> <p><b>61-28990-20</b> 072 103 383 DB 78 Ø 1,6 mm 3  Mot.→ACL 014 031</p>  <p><b>61-31960-00</b> 075 103 383 D 78 Ø 1,53 mm 1  MLS Mot.ACL 014 032→</p> <p><b>61-31960-10</b> 075 103 383 E 78 Ø 1,57 mm 2  MLS Mot.ACL 014 032→</p> <p><b>61-31960-20</b> 075 103 383 F 78 Ø 1,61 mm 3  MLS Mot.ACL 014 032→</p> 	<p><b>14-32047-03</b> 068 103 384 A (14x)</p> 	<p><b>71-29358-00</b> 075 103 483 F Gummi</p> 	<p><b>12-25837-03</b> 026 109 675 (12x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-24768-10</b> 072 129 717 A</p> <p>12x </p>		<p><b>71-27898-20 R</b> 026 129 589 A</p>  <p><b>71-28186-20 L</b> 034 129 589 B</p> 	<p>3x <b>71-33184-00</b> 075 103 609 C</p>  <p>3x</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p><b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM</p>




























VOLKSWAGEN													
Ltr.			<b>1</b>										
2,4 ACT	51 kW (69-70 PS)	LT D	08/89-06/96	<p><b>61-28990-00</b> 072 103 383 CT 78 Ø 1,5 mm 1 </p> <p>Mot.→ACT 011 319</p> <p><b>61-28990-10</b> 072 103 383 DA 78 Ø 1,55 mm 2 </p> <p>Mot.→ACT 011 319</p> <p><b>61-28990-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 </p> <p>Mot.→ACT 011 319</p> <p><b>61-31960-00</b> 075 103 383 D 78 Ø 1,53 mm 1 </p> <p>MLS Mot.ACT 011 320→</p> <p><b>61-31960-10</b> 075 103 383 E 78 Ø 1,57 mm 2 </p> <p>MLS Mot.ACT 011 320→</p> <p><b>61-31960-20</b> 075 103 383 F 78 Ø 1,61 mm 3 </p> <p>MLS Mot.ACT 011 320→</p>	<p><b>14-32047-03</b> 068 103 384 A (14x)</p>	<p><b>71-29358-00</b> 075 103 483 F Gummi</p>	<p><b>12-25837-03</b> 026 109 675 (12x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-24768-10</b> 072 129 717 A</p>		<p><b>71-27898-20 R</b> 026 129 589 A</p> <p><b>71-28186-20 L</b> 034 129 589 B</p>	<p>3x <b>71-33184-00</b> 075 103 609 C</p> <p>3x</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p><b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM</p>	
2,4 AJA	55 kW (75 PS)	TRANSPORTER	08/97-04/03	<p><del><b>02-28988-03</b> <sup>12</sup></del> </p> <p><del><b>08-29178-03</b> <sup>13</sup></del> 074 198 011 B Mot.→AJA 028 554</p> <p><del><b>08-29178-04</b> <sup>13 35</sup></del> Mot.AJA 028 555→</p> <p><del><b>08-34213-01</b> <sup>13 35</sup></del> Mot.→AJA 050 000</p> <p>Mot.AJA 050 001→</p>	<p><b>61-29471-30</b> 074 103 383 M 81 Ø 1,53 mm 1 </p> <p>MLS</p> <p><b>61-29471-40</b> 074 103 383 N 81 Ø 1,57 mm 2 </p> <p>MLS</p> <p><b>61-29471-50</b> 074 103 383 P 81 Ø 1,61 mm 3 </p> <p>MLS</p>	<p><b>14-32047-02</b> 068 103 384 A (12x)</p>	<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p>		<p><b>71-27898-20</b> 026 129 589 A</p>	<p>5x <b>71-29178-10</b> 074 103 609 F Mot.→AJA 050 000</p> <p><b>71-34213-00</b> 074 103 609 H Metall Mot.AJA 050 001→</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p>Mot.→AJA 028 554</p> <p><b>81-90000-00 K</b> → </p> <p>028 103 171 B Mot.AJA 028 555→</p> <p><b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM</p>	
2,4 CP	55 kW (75 PS)	LT D	→28 B 014 816 12/78-07/92	<p><b>02-12992-03</b> <sup>12</sup> 076 198 015 B</p> <p><del></del></p> <p><b>08-24468-03</b> <sup>13</sup> 075 198 011 B</p>	<p><b>61-24770-60</b> 072 103 383 DH 78,5 Ø 1,55 mm 2 </p> <p><b>61-24770-70</b> 072 103 383 DJ 78,5 Ø 1,6 mm 3 </p>		<p><b>15-12992-01</b> 072 198 025</p>	<p><b>12-25837-03</b> 026 109 675 (12x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-24768-10</b> 072 129 717 A</p>		<p><b>71-27898-20</b> 026 129 589 A</p> <p><b>71-23662-20</b> </p> <p>043 251 241 A</p> <p><b>71-24068-10</b> </p> <p>433 253 115</p>	<p>6x <b>71-24468-10</b> 075 103 609 B</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM</p> <p><b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM</p>

VOLKSWAGEN														
2.4 CP	55 kW (75 PS)	LT D	28 J 014 817→	12/78-07/92	<b>02-13020-04</b> <sup>12</sup> 072 198 012 A  <b>08-24468-03</b> <sup>13</sup> 075 198 011 B	<b>61-28990-00</b> 072 103 383 CT 78 Ø 1,5 mm 1 <b>61-28990-10</b> 072 103 383 DA 78 Ø 1,55 mm 2 <b>61-28990-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 	<b>14-32047-03</b> 068 103 384 A (14x) 	<b>15-13020-02</b> 072 198 025 A 	<b>12-25837-03</b> 026 109 675 (12x) <b>70-25837-00</b> 026 109 675 12x	<b>71-24768-10</b> 072 129 717 A 	<b>71-27898-20</b> 026 129 589 A 6x  <b>71-23662-20</b> 043 251 241 A  <b>71-24068-10</b> 433 253 115	<b>71-24468-10</b> 075 103 609 B 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM	
2.4 DL 1E	66-69 kW (90-94 PS)	LT		12/82-06/96	<b>02-26050-02</b> 073 198 012 A <b>08-24468-03</b> <sup>13</sup> 075 198 011 B	<b>61-26050-10</b> 073 103 383 C 78,5 Ø 1,9 mm 	<b>14-32047-03</b> 068 103 384 A (14x) 	<b>15-13025-01</b> 073 198 025 	<b>12-25837-03</b> 026 109 675 (12x) <b>70-25837-00</b> 026 109 675 12x	<b>71-24768-10</b> 072 129 717 A 	<b>71-27898-20</b> 026 129 589 A 6x  <b>71-24068-10</b> 433 253 115	<b>71-24468-10</b> 075 103 609 B 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
2.4 DV DW 1G	55-75 kW (75-102 PS)	LT D LT TD	→28 J 014 000 08/78-09/93 →28 J 014 000		<b>02-13020-04</b> <sup>12</sup> 072 198 012 A  <b>08-24468-03</b> <sup>13</sup> 075 198 011 B	<b>61-26045-20</b> 072 103 383 DF 78,5 Ø 1,55 mm 2 <b>61-26045-30</b> 072 103 383 DG 78,5 Ø 1,6 mm 3 	<b>14-32047-03</b> 068 103 384 A (14x) 	<b>15-13020-02</b> 072 198 025 A 	<b>12-25837-03</b> 026 109 675 (12x) <b>70-25837-00</b> 026 109 675 12x	<b>71-24768-10</b> 072 129 717 A 	<b>71-27898-20 R</b> 026 129 589 A 3x  <b>71-28186-20 L</b> 034 129 589 B 3x  <b>71-25381-00</b> 075 253 115	<b>71-24468-10</b> 075 103 609 B 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM	
2.4 DV DW 1G	55-75 kW (75-102 PS)	LT D LT TD	28 J 014 001→ 08/78-09/93 28 J 014 001→		<b>02-13020-04</b> <sup>12</sup> 072 198 012 A  <b>08-24468-03</b> <sup>13</sup> 075 198 011 B	<b>61-28990-00</b> 072 103 383 CT 78 Ø 1,5 mm 1 <b>61-28990-10</b> 072 103 383 DA 78 Ø 1,55 mm 2 <b>61-28990-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 	<b>14-32047-03</b> 068 103 384 A (14x) 	<b>15-13020-02</b> 072 198 025 A 	<b>12-25837-03</b> 026 109 675 (12x) <b>70-25837-00</b> 026 109 675 12x	<b>71-24768-10</b> 072 129 717 A 	<b>71-27898-20 R</b> 026 129 589 A 3x  <b>71-28186-20 L</b> 034 129 589 B 3x  <b>71-25381-00</b> 075 253 115	<b>71-24468-10</b> 075 103 609 B 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM	
2.4 1S	51 kW (69-70 PS)	LT D		08/89-06/96	<b>02-13020-04</b> <sup>12</sup> 072 198 012 A  <b>08-24468-03</b> <sup>13</sup> 075 198 011 B	<b>61-28990-00</b> 072 103 383 CT 78 Ø 1,5 mm 1 <b>61-28990-10</b> 072 103 383 DA 78 Ø 1,55 mm 2 <b>61-28990-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 	<b>14-32047-03</b> 068 103 384 A (14x) 	<b>15-13020-02</b> 072 198 025 A 	<b>12-25837-03</b> 026 109 675 (12x) <b>70-25837-00</b> 026 109 675 12x	<b>71-24768-10</b> 072 129 717 A 	<b>71-27898-20</b> 026 129 589 A 6x  <b>71-23662-20</b> 043 251 241 A  <b>71-24068-10</b> 433 253 115	<b>71-24468-10</b> 075 103 609 B 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM	



VOLKSWAGEN													
2,5 AAF ACU AEN	81 kW (110 PS)	TRANSPORTER	11/90-04/03	<b>02-28715-01</b> <sup>12</sup> 023 198 012 <b>08-29178-03</b> <sup>13</sup> 074 198 011 B	<b>61-28715-00</b> 023 103 383 B 81 Ø 1,75 mm 	<b>14-32047-02</b> 068 103 384 A (12x) 	<b>15-28988-01</b> 	<b>12-25837-02</b> 026 109 675 (10x) <b>70-25837-00</b> 026 109 675	10x <b>71-27119-10</b> 034 129 717 F 		5x <b>71-27898-20</b> 026 129 589 A 	5x <b>71-29178-10</b> 074 103 609 F 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
2,5 ACV	75 kW (102 PS)	TRANSPORTER	09/95-04/03	<del><b>02-28988-03</b> <sup>12</sup></del>  <del><b>08-29178-03</b> <sup>13</sup></del>  <b>08-29178-03</b> <sup>13</sup> 074 198 011 B Mot.→ACV 115 395 <b>08-29178-04</b> <sup>13 35</sup> Mot.AC.V 115 396→ Mot.→ACV 185 000 <b>08-34213-01</b> <sup>13 35</sup> Mot.AC.V 185 001→	<b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 □ MLS <b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 □ MLS <b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 □ MLS 	<b>14-32047-02</b> 068 103 384 A (12x) 	<b>71-42172-00</b> X 	<b>12-25837-02</b> 026 109 675 (10x) <b>70-25837-00</b> 026 109 675	10x <b>71-29179-00</b> 074 129 717 		5x <b>71-27898-20</b> 026 129 589 A 	5x <b>71-29178-10</b> 074 103 609 F Mot.→ACV 185 000  <b>71-34213-00</b> 074 103 609 H Metall Mot.AC.V 185 001→ 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM Mot.→ACV 115 395 <b>81-90000-00 K</b> → 028 103 171 B Mot.AC.V 115 396→ <b>81-19299-10 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
2,5 AET	85 kW (115 PS)	TRANSPORTER	07/96-04/03	<b>02-28715-02</b> <sup>12</sup> <b>08-29178-03</b> <sup>13</sup> 074 198 011 B Mot.→AET 017 277 <b>08-29178-04</b> <sup>13 35</sup> Mot.AET 017 278→ Mot.→AET 025 000 <b>08-34213-01</b> <sup>13 35</sup> Mot.AET 025 001→	<b>61-28715-00</b> 023 103 383 B 81 Ø 1,75 mm 	<b>14-32047-02</b> 068 103 384 A (12x) 		<b>12-25837-02</b> 026 109 675 (10x) <b>70-25837-00</b> 026 109 675	10x <b>71-27119-10</b> 034 129 717 F 		5x <b>71-27898-20</b> 026 129 589 A 	5x <b>71-29178-10</b> 074 103 609 F Mot.→AET 025 000  <b>71-34213-00</b> 074 103 609 H Metall Mot.AET 025 001→ 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM Mot.→AET 017 277 <b>81-90000-00 K</b> → 028 103 171 B Mot.AET 017 278→ <b>81-34367-00 N</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>81-34368-00 N</b> → 028 103 086 32x47x10 A SL LD PTFE ACM
2,5 AEU	81 kW (110 PS)	TRANSPORTER	11/90-04/03	<b>02-28715-02</b> <sup>12</sup> <b>08-29178-03</b> <sup>13</sup> 074 198 011 B Mot.→AEU 002 001 <b>08-29178-04</b> <sup>13 35</sup> Mot.AEU 002 002→ Mot.→AEU 003 000 <b>08-34213-01</b> <sup>13 35</sup> Mot.AEU 003 001→	<b>61-28715-00</b> 023 103 383 B 81 Ø 1,75 mm 	<b>14-32047-02</b> 068 103 384 A (12x) 		<b>12-25837-02</b> 026 109 675 (10x) <b>70-25837-00</b> 026 109 675	10x <b>71-27119-10</b> 034 129 717 F 		5x <b>71-27898-20</b> 026 129 589 A 	5x <b>71-29178-10</b> 074 103 609 F Mot.→AEU 003 000  <b>71-34213-00</b> 074 103 609 H Metall Mot.AEU 003 001→ 	<b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM Mot.→AEU 002 001 <b>81-90000-00 K</b> → 028 103 171 B Mot.AEU 002 002→ <b>81-34367-00 N</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>81-34368-00 N</b> → 028 103 086 32x47x10 A SL LD PTFE ACM

VOLKSWAGEN

Ltr.	Power	Engine	Year	Part 1	Part 2	Part 3	Part 4	Part 5	Part 6	Part 7	Part 8	Part 9	Part 10
2,5 AGX	55 kW (75 PS)	LT SDI	07/96-07/06	<p><b>02-28988-03</b> <sup>12</sup></p>   <p><b>08-29178-03</b> <sup>13</sup> 074 198 011 B Mot.→AGX 009 000</p> <p><b>08-29178-04</b> <sup>13 35</sup> Mot.AGX 009 001→ Mot.→AGX 016 876</p> <p><b>08-34213-01</b> <sup>13 35</sup> Mot.AGX 016 877→</p>	<p><b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 □ MLS</p> <p><b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 □ MLS</p> <p><b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 □ MLS</p> 	<p><b>14-32047-02</b> 068 103 384 A (12x)</p> 	<p><b>71-42172-00</b> <sup>X</sup></p> 	<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p> 		<p><b>71-27898-20</b> 026 129 589 A</p> 	<p>5x <b>71-29178-10</b> 074 103 609 F Mot.→AGX 016 876</p>  <p><b>71-34213-00</b> 074 103 609 H Metall Mot.AGX 016 877→</p> 	<p><b>81-24292-10</b> K ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-23708-40</b> K → 068 103 051 P 85x105x11 A SL LD FPM Mot.→AGX 009 000</p> <p><b>81-90000-00</b> K → <sup>A</sup> 028 103 171 B Mot.AGX 009 001→</p> <p><b>81-19299-10</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM</p>
2,5 AHD	75 kW (102 PS)	LT TDI	05/96-08/99	<p><b>02-28988-03</b> <sup>12</sup></p>   <p><b>08-29178-03</b> <sup>13</sup> 074 198 011 B Mot.→AHD 036 065</p> <p><b>08-29178-04</b> <sup>13 35</sup> Mot.AHD 036 066→ Mot.→AHD 063 000</p> <p><b>08-34213-01</b> <sup>13 35</sup> Mot.AHD 063 001→</p>	<p><b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 □ MLS</p> <p><b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 □ MLS</p> <p><b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 □ MLS</p> 	<p><b>14-32047-02</b> 068 103 384 A (12x)</p> 	<p><b>71-42172-00</b> <sup>X</sup></p> 	<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p> 		<p><b>71-27898-20</b> 026 129 589 A</p> 	<p>5x <b>71-29178-10</b> 074 103 609 F Mot.→AHD 063 000</p>  <p><b>71-34213-00</b> 074 103 609 H Metall Mot.AHD 063 001→</p> 	<p><b>81-24292-10</b> K ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-23708-40</b> K → 068 103 051 P 85x105x11 A SL LD FPM Mot.→AHD 036 065</p> <p><b>81-90000-00</b> K → <sup>A</sup> 028 103 171 B Mot.AHD 036 066→</p> <p><b>81-19299-10</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM</p>
2,5 AHY	111 kW (151 PS)	TRANSPORTER	05/98-04/03	<p><b>02-28988-04</b> <sup>12</sup></p>   <p><b>08-29178-04</b> <sup>13 35</sup> Mot.→AHY 005 000</p> <p><b>08-34213-01</b> <sup>13 35</sup> Mot.AHY 005 001→</p>	<p><b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 □ MLS</p> <p><b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 □ MLS</p> <p><b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 □ MLS</p> 	<p><b>14-32047-02</b> 068 103 384 A (12x)</p> 	<p><b>71-42172-00</b> <sup>X</sup></p> 	<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p> 		<p><b>71-27898-20</b> 026 129 589 A</p> 	<p>5x <b>71-29178-10</b> 074 103 609 F Mot.→AHY 005 000</p>  <p><b>71-34213-00</b> 074 103 609 H Metall Mot.AHY 005 001→</p> 	<p><b>81-24292-10</b> K ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90000-00</b> K → <sup>A</sup> 028 103 171 B</p> <p><b>81-34367-00</b> N ← 038 103 085 A 32x47x10 A SL RD PTFE ACM</p> <p><b>81-34368-00</b> N → 028 103 086 32x47x10 A SL LD PTFE ACM</p>


VOLKSWAGEN												
2,5 AJT	65 kW (88 PS)	TRANSPORTER	05/98-04/03	<p><del>02-28988-04</del> <sup>12</sup></p> <p><del>08-29178-04</del> <sup>13 35</sup> Mot.→AJT 016 000</p> <p><del>08-34213-01</del> <sup>13 35</sup> Mot.AJT 016 001→</p>	<p><b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 <input type="checkbox"/> MLS</p> <p><b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 <input type="checkbox"/> MLS</p> <p><b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p><b>14-32047-02</b> 068 103 384 A (12x)</p>	<p><del>71-42172-00</del> <sup>X</sup></p>	<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p> <p>10x </p>	<p><b>71-27898-20</b> 026 129 589 A</p> <p>5x </p>	<p><b>71-29178-10</b> 074 103 609 F Mot.→AJT 016 000</p> <p><b>71-34213-00</b> 074 103 609 H Metall</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90000-00 K</b> → </p> <p>028 103 171 B <b>81-34367-00 N</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM</p> <p><b>81-34368-00 N</b> → 028 103 086 32x47x10 A SL LD PTFE ACM</p>
2,5 ANF ANG ANH	55-111 kW (75-151 PS)			<p><del>02-28988-04</del> <sup>12</sup></p> <p><del>08-34213-01</del> <sup>13 35</sup></p>	<p><b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 <input type="checkbox"/> MLS</p> <p><b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 <input type="checkbox"/> MLS</p> <p><b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p><b>14-32047-02</b> 068 103 384 A (12x)</p>		<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p> <p>10x </p>	<p><b>71-27898-20</b> 026 129 589 A</p> <p>5x </p>	<p><b>71-34213-00</b> 074 103 609 H Metall</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90000-00 K</b> → </p> <p>028 103 171 B <b>81-34367-00 N</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM</p> <p><b>81-34368-00 N</b> → 028 103 086 32x47x10 A SL LD PTFE ACM</p>
2,5 ANJ APA AUF AVR AXG AXL AYC AYY BBE BBF	61-111 kW (83-151 PS)	LT TDI TRANSPORTER	09/95-07/06	<p><del>02-28988-04</del> <sup>12</sup></p> <p><del>08-34213-01</del> <sup>13 35</sup></p>	<p><b>61-31950-30</b> 074 103 383 AJ 81,7 Ø 1,53 mm 1 <input type="checkbox"/> MLS</p> <p><b>61-31950-40</b> 074 103 383 AH 81,7 Ø 1,57 mm 2 <input type="checkbox"/> MLS</p> <p><b>61-31950-50</b> 074 103 383 AG 81,7 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p><b>14-32047-02</b> 068 103 384 A (12x)</p>	<p><del>71-42172-00</del> <sup>X</sup></p>	<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-29179-00</b> 074 129 717</p> <p>10x </p>	<p><b>71-27898-20</b> 026 129 589 A</p> <p>5x </p>	<p><b>71-34213-00</b> 074 103 609 H Metall</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90000-00 K</b> → </p> <p>028 103 171 B <b>81-34367-00 N</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM</p> <p><b>81-34368-00 N</b> → 028 103 086 32x47x10 A SL LD PTFE ACM</p>
2,5 APL AVT	85 kW (115 PS)	TRANSPORTER	07/96-04/03	<p><del>02-28715-02</del> <sup>12</sup></p> <p><del>08-34213-01</del> <sup>13 35</sup></p>	<p><b>61-28715-00</b> 023 103 383 B 81 Ø 1,75 mm</p>	<p><b>14-32047-02</b> 068 103 384 A (12x)</p>		<p><b>12-25837-02</b> 026 109 675 (10x)</p> <p><b>70-25837-00</b> 026 109 675</p>	<p><b>71-27119-10</b> 034 129 717 F</p> <p>10x </p>	<p><b>71-27898-20</b> 026 129 589 A</p> <p>5x </p>	<p><b>71-34213-00</b> 074 103 609 H Metall</p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90000-00 K</b> → </p> <p>028 103 171 B <b>81-34367-00 N</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM</p> <p><b>81-34368-00 N</b> → 028 103 086 32x47x10 A SL LD PTFE ACM</p>

VOLKSWAGEN												
2,5 AXD AXE BLJ	96-128 kW (130-174 PS)	TRANSPORTER	04/03-11/09	<p>02-38317-01 <sup>12</sup></p> <p>08-38332-01 <sup>13</sup></p>	<p>61-36105-00 070 103 383 M 1,27 mm 1 □ MLS</p> <p>61-36105-10 070 103 383 N 1,35 mm 2 □ MLS</p> <p>61-36105-20 070 103 383 P 1,43 mm 3 □ MLS</p>	<p>14-32190-01 070 103 384 (12x)</p>	<p>70-31414-10</p>	<p>12-26058-06 027 109 675 (10x)</p> <p>70-26058-00 027 109 675</p>	<p>71-36074-00 070 129 717 A 10x Zyl. 2-3</p> <p>71-36076-00 070 129 717 Zyl. 1</p> <p>71-36079-00 070 129 717 B Zyl. 4-5</p> <p>2x</p>	<p>71-36106-00 070 253 039 C</p>	<p>70-31414-10</p>	<p>81-35916-00 K → 070 103 051 A 85x105x12 A SL LD PTFE ACM</p>
2,5 BJJ BJK BJL BJM	65-120 kW (88-163 PS)	BUS 30-35 KASTEN 30-50 PRITSCHEN 30-50	04/06→	<p>02-38077-01 <sup>12</sup></p> <p>08-38443-01 <sup>13</sup> <sup>38</sup></p>	<p>61-37025-00 076 103 383 C 81,5 Ø 1,53 mm 1 □ MLS</p> <p>61-37025-10 076 103 383 D 81,5 Ø 1,57 mm 2 □ MLS</p> <p>61-37025-20 076 103 383 E 81,5 Ø 1,61 mm 3 □ MLS</p>	<p>14-32047-02 068 103 384 A (12x)</p>	<p>71-42172-00 X</p>	<p>12-25837-02 026 109 675 (10x)</p> <p>70-25837-00 026 109 675</p>	<p>71-29179-00 074 129 717 10x</p>	<p>71-33078-00 074 253 039</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-34367-00 N ← 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,5 BNZ BPC	96-128 kW (130-174 PS)	TRANSPORTER	04/03-11/09	<p>02-38318-01 <sup>12</sup></p> <p>08-38332-01 <sup>13</sup></p>	<p>61-36105-00 070 103 383 M 1,27 mm 1 □ MLS</p> <p>61-36105-10 070 103 383 N 1,35 mm 2 □ MLS</p> <p>61-36105-20 070 103 383 P 1,43 mm 3 □ MLS</p>	<p>14-32190-01 070 103 384 (12x)</p>	<p>70-31414-10</p>	<p>12-26058-06 027 109 675 (10x)</p> <p>70-26058-00 027 109 675</p>	<p>71-37536-00 070 129 717 C 2x Zyl. 4-5</p> <p>71-37537-00 070 129 717 D Zyl. 2-3</p> <p>71-37538-00 070 129 717 E Zyl. 1</p>	<p>71-36106-00 070 253 039 C</p>	<p>70-31414-10</p>	<p>81-35916-00 K → 070 103 051 A 85x105x12 A SL LD PTFE ACM</p>

VOLKSWAGEN													
2,5 CEBA CEBB CECA CECB	65-120 kW (88-163 PS)	BUS 30-35 KASTEN 30-50 PRITSCHEN 30-50	04/06→	02-38077-01 <sup>12</sup>  08-38443-01 <sup>13</sup> <sup>38</sup>	61-37025-00 076 103 383 C 81,5 Ø 1,53 mm 1 MLS 61-37025-10 076 103 383 D 81,5 Ø 1,57 mm 2 MLS 61-37025-20 076 103 383 E 81,5 Ø 1,61 mm 3 MLS 	14-32047-02 068 103 384 A (12x) 	71-42172-00 <sup>X</sup> 	12-25837-02 026 109 675 (10x) 70-25837-00 026 109 675	71-29179-00 074 129 717 10x		71-33078-00 074 253 039 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90039-00 K → 076 103 171 B PTFE 81-34367-00 N ← 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,8 AES	103 kW (140 PS)	TRANSPORTER	11/95-05/00	08-27321-02 <sup>13</sup> 021 198 011 A Mot.→AES 009 433	61-29110-00 021 103 383 H 83,5 Ø 1,65 mm Mot.→AES 009 433  61-34125-00 021 103 383 N 83 Ø MLS Mot.AES 009 434→ 	14-32056-01 021 103 384 D (10x) +021 103 384 E (7x) +021 103 384 F (3x) Mot.→AES 009 433  14-32174-02 021 103 384 G (10x) +021 103 384 K (7x) +021 103 384 L (3x) Mot.AES 009 434→ 		12-26058-01 027 109 675 (12x) 70-26058-00 027 109 675	71-34099-00 021 133 227 K 12x 71-31409-00 <sup>10</sup> 021 133 227 H 		71-29435-10 021 253 039 E  71-29440-10 021 253 050 B 	71-27321-10 021 103 609 B Metall Mot.→AES 009 433  70-31414-10 Mot.AES 009 434→ 	81-24292-10 K ← 054 115 147 B 35x48x10 A SL RD FPM 81-23708-40 K → 068 103 051 P 85x105x11 A SL LD FPM
2,8 AGK ATA	92-96 kW (125-130 PS)	LT TDI	07/97-07/06	02-36075-01 <sup>12</sup> 08-36088-01 <sup>13</sup>	61-36075-00 062 103 383 A 96 Ø 	14-32178-01 062 103 384 (10x) 	71-36054-00 062 103 483 	12-36082-01 062 109 675 (12x) 70-36082-00 062 109 675	71-36062-00 062 129 717 12x		71-36089-00 062 129 589 	4x 71-36088-00 062 103 609 	81-37609-00 K ← 062 115 147 64x80x9 B SL RD FPM 81-37611-00 K → 062 103 051 91x111x10 AB SL LD FPM
2,8 AMV	150 kW (204 PS)	TRANSPORTER	04/00-04/03	02-34265-02 <sup>12</sup> 08-36863-01 <sup>13</sup>	61-34265-00 022 103 383 F 82,5 Ø MLS 	14-32129-02 022 103 384 C (13x) +022 103 384 D (7x) 	71-34101-00 022 103 483 E 	12-31306-05 036 109 675 (24x) 70-31306-00 036 109 675	71-36119-00 022 133 227 A 24x		71-34092-00 022 253 039 B Zyl. 1-3  71-34093-00 022 253 050 B Zyl. 4-6 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-34819-00 K → 021 103 051 C 85x105x11 A SL LD PTFE ACM
2,8 AUH BCQ	116 kW (158 PS)	LT TDI	05/01-07/06	02-00011-01 <sup>12</sup> 08-36088-01 <sup>13</sup>	61-00011-00 062 103 383 B 96 Ø MLS 	14-32178-01 062 103 384 (10x) 	71-36054-00 062 103 483 	12-36082-01 062 109 675 (12x) 70-36082-00 062 109 675	71-36062-00 062 129 717 12x		71-36089-00 062 129 589 	4x 71-36088-00 062 103 609 	81-37609-00 K ← 062 115 147 64x80x9 B SL RD FPM 81-37611-00 K → 062 103 051 91x111x10 AB SL LD FPM



VOLKSWAGEN

Ltr. 



1

3,0 BSP

165 kW  
(224 PS)



**02-36049-01** <sup>12</sup>  
Zyl. 1-3




**02-36051-01** <sup>12</sup>  
Zyl. 4-6




**08-38329-01** <sup>13</sup>


**61-35965-00**  
059 103 383 CM  
1,1 mm 1   
MLS  
Zyl. 1-3




**61-35965-10**  
059 103 383 CN  
1,15 mm 2   
MLS  
Zyl. 1-3




**61-35965-20**  
059 103 383 CP  
1,2 mm 3   
MLS  
Zyl. 1-3





**61-35970-00**  
059 103 383 CQ  
1,1 mm 1   
MLS  
Zyl. 4-6



**61-35970-10**  
059 103 383 CR  
1,15 mm 2   
MLS  
Zyl. 4-6



**61-35970-20**  
059 103 383 CS  
1,2 mm 3   
MLS  
Zyl. 4-6




**14-32196-01**  
057 103 384 A (8x)




2x

**71-36049-00**  
059 103 483 N  
Zyl. 1-3

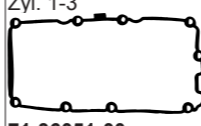

**71-36051-00**  
059 103 483 M  
Zyl. 4-6




**12-31306-08**  
036 109 675 (12x)

**70-31306-00**  
036 109 675

2x

**71-36069-00**  
059 129 717 J



24x

2x

**71-36117-00**  
059 253 039 D



2x


**70-31414-10**



**81-36027-00 K** ←  
079 103 051 D  
55x70x8  
A SL RD PTFE

**81-35553-00 K** →  
079 103 051 F  
85x105x8,8  
A SL LD PTFE ACM

**81-19299-10 N**  
068 103 085 E  
32x47x10  
A SL WD FPM





VOLKSWAGEN													
Ltr.			<b>1</b>	<p><b>02-36049-02</b> <sup>12</sup> Zyl. 1-3 </p> <p><b>02-36051-02</b> <sup>12</sup> Zyl. 4-6 </p> <p><b>08-39131-01</b> <sup>13</sup></p>	<p><b>61-35965-00</b> 059 103 383 CM 1,1 mm 1 </p> <p>MLS Zyl. 1-3</p> <p><b>61-35965-10</b> 059 103 383 CN 1,15 mm 2 </p> <p>MLS Zyl. 1-3</p> <p><b>61-35965-20</b> 059 103 383 CP 1,2 mm 3 </p> <p>MLS Zyl. 1-3</p> <p><b>61-35970-00</b> 059 103 383 CQ 1,1 mm 1 </p> <p>MLS Zyl. 4-6</p> <p><b>61-35970-10</b> 059 103 383 CR 1,15 mm 2 </p> <p>MLS Zyl. 4-6</p> <p><b>61-35970-20</b> 059 103 383 CS 1,2 mm 3 </p> <p>MLS Zyl. 4-6</p>	<p><b>14-32196-01</b> 2x 057 103 384 A (8x) </p>	<p><b>71-36049-00</b> 059 103 483 N Zyl. 1-3 </p> <p><b>71-36051-00</b> 059 103 483 M Zyl. 4-6 </p>	<p><b>12-31306-05</b> 036 109 675 (24x) <b>70-31306-00</b> 036 109 675</p>	<p><b>71-36069-00</b> 2x 059 129 717 J 24x </p>		<p><b>71-36117-00</b> 2x 059 253 039 D </p>	<p><b>70-31414-10</b> </p>	<p><b>81-36027-00</b> K ← 079 103 051 D 55x70x8 A SL RD PTFE <b>81-35553-00</b> K → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>81-19299-10</b> N 068 103 085 E 32x47x10 A SL WD FPM</p>
3,2 BDL BKK	170-173 kW (231-235 PS)	TRANSP. →7H 5 070 000	04/03-11/09	<b>02-36090-01</b> <sup>12</sup>	<p><b>61-36090-00</b> 022 103 383 M 85 Ø MLS </p>	<p><b>14-32193-01</b> 022 103 384 L (13x) +022 103 384 M (7x) </p>	<p><b>71-34101-00</b> 022 103 483 E </p>	<p><b>12-31306-05</b> 036 109 675 (24x) <b>70-31306-00</b> 036 109 675</p>	<p><b>71-36058-00</b> 022 133 237 C 24x </p>		<p><b>71-36091-00</b> 022 253 039 E Zyl. 1-3 </p> <p><b>71-36092-00</b> 022 253 050 C Zyl. 4-6 </p>	<p><b>70-31414-10</b> </p>	<p><b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-34819-00</b> K → 021 103 051 C 85x105x11 A SL LD PTFE ACM</p>
3,2 BDL BKK	170-173 kW (231-235 PS)	TRANSP. 7H 5 070 001→	04/03-11/09	<b>02-36090-01</b> <sup>12</sup>	<p><b>61-36090-00</b> 022 103 383 M 85 Ø MLS </p>	<p><b>14-32193-01</b> 022 103 384 L (13x) +022 103 384 M (7x) </p>	<p><b>71-34101-00</b> 022 103 483 E </p>	<p><b>12-31306-05</b> 036 109 675 (24x) <b>70-31306-00</b> 036 109 675</p>	<p><b>71-36058-00</b> 022 133 237 C 24x </p>		<p><b>71-36091-00</b> 022 253 039 E Zyl. 1-3 </p> <p><b>71-36092-00</b> 022 253 050 C Zyl. 4-6 </p>	<p><b>70-31414-10</b> </p>	<p><b>81-90040-00</b> K ← </p> <p>022 103 151 D <b>81-34819-00</b> K → 021 103 051 C 85x105x11 A SL LD PTFE ACM</p>